

AD-A142 753


FUSELAGE TORSION OF A CT4 AIRCRAFT(U) AERONAUTICAL
RESEARCH LABS MELBOURNE (AUSTRALIA) P M COX ET AL.
DEC 83 ARL/STRUC-TM-368


1/1

UNCLASSIFIED

F/G 14/2

NL

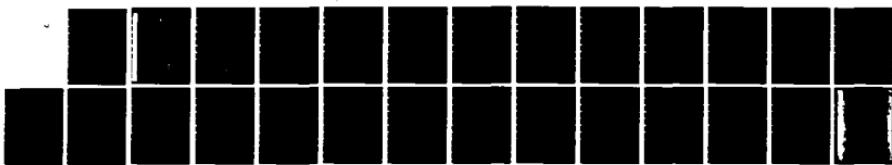

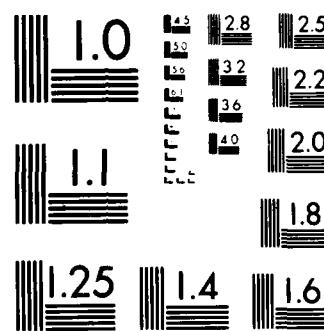

MICROCOPY RESOLUTION TEST CHART
NATIONAL BUREAU OF STANDARDS 1963-A

Unclassified

12

ARL-STRUC-TECH-MEMO-368

AR-002-990



DEPARTMENT OF DEFENCE
DEFENCE SCIENCE AND TECHNOLOGY ORGANISATION
AERONAUTICAL RESEARCH LABORATORIES

MELBOURNE, VICTORIA

THE UNITED STATES NATIONAL
TECHNICAL INFORMATION SERVICE
IS AUTHORISED TO
REPRODUCE AND SELL THIS REPORT

Structures Technical Memorandum 368

AD-A142 753

DTIC FILE COPY

FUSELAGE TORSION OF A CT4 AIRCRAFT

by

PETRA M. COX

6

A. GOLDMAN

APPROVED FOR PUBLIC RELEASE



(C) COMMONWEALTH OF AUSTRALIA 1983

COPY NO

December 1983

UNCLASSIFIED
54 07 09 010

DEPARTMENT OF DEFENCE
DEFENCE SCIENCE AND TECHNOLOGY ORGANISATION
AERONAUTICAL RESEARCH LABORATORIES

Structures Technical Memorandum 368

FUSELAGE TORSION OF A CT4 AIRCRAFT

by

PETRA M. COX

&

A. GOLDMAN

SUMMARY

The fuselage torsion mode of a CT4 aircraft has been examined using an impulsive testing technique. The mode shape and natural frequency are presented.



© COMMONWEALTH OF AUSTRALIA 1983

POSTAL ADDRESS: Director, Aeronautical Research Laboratories,
P.C. Box 4331, Melbourne, Victoria, 3001, Australia.

CONTENTS

PAGE NO.

1. INTRODUCTION	1
2. TEST PROCEDURE	1
3. RESULTS	2
4. CONCLUSIONS	2

REFERENCES

TABLE

FIGURES

DISTRIBUTION

DOCUMENT CONTROL DATA

Accession For	
NTIS GRA&I	<input checked="" type="checkbox"/>
DTIC TAB	<input type="checkbox"/>
Unannounced	<input type="checkbox"/>
Justification	
By _____	
Distribution/ _____	
Availability Codes	
Dist	Avail and/or Special
A-1	



1. INTRODUCTION

In reference 1, the natural modes and frequencies of a CT4 tailplane were presented. Subsequent to this, a lightly damped anti-symmetric tailplane vibration, at 11 hertz, was recorded in flight. A vibration at this frequency is noted in reference 1 but, at that time, was considered to be the elevator rotation mode, and was not investigated further due to time limitations.

Aircraft number A19-071 was made available by the RAAF, and a period of one day was allocated for the investigation of this mode to be carried out at Point Cook.

2. TEST PROCEDURE

Because the vibration to be investigated appeared lightly damped, and because the modes of vibration appeared well separated, an impulse technique was considered suitable. This enabled the test to be carried out with minimum equipment, and in a much shorter time than for the more traditional ground vibration test method, using multiple shakers and a distributed force input.

The equipment required for this test procedure was a two-channel FFT spectrum analyser, two accelerometers, a portable computer, a digital plotter and a hammer. A tape recorder was also used to store the data for future processing if needed.

The aircraft was in a fully serviceable condition, with all controls locked to prevent control surface rotation beyond the limits of backlash. No attempt was made to obtain a low frequency suspension for the aircraft.

Measuring stations were marked on the tailplane, fin and fuselage as shown in Figure 1. The actual locations are listed in Table 1. Measuring stations were also located on the leading and trailing edges of the wing tips.

An accelerometer was attached to the structure at location T2B, to act as a reference while another accelerometer was attached to the structure at each of the measuring stations listed in Table 1 in succession. For each location of the travelling accelerometer, the aircraft was excited by a number of impulses applied manually close to location T2B. The average response was measured for both locations and the root-mean-square spectrum obtained. Figures 2 to 11 show the spectra for the extremities of the structure. Slight variations in input levels were corrected for by using the transfer function of the response with reference to the fixed accelerometer output. The amplitude of the transfer function at 11.4 hertz was taken to be the amplitude of the mode at that location. The phase of the transfer function at this frequency was recorded and used to determine the mode shape. After measuring in some detail around the tail of the aircraft it became clear that the mode under

investigation did not include any bending or torsion of the tailplane or fin. Measurements were then taken along the fuselage and on the wing tips to confirm the suspicion that the mode is a fuselage torsion mode.

In order to estimate the damping of the mode the recorded time-history was passed through an 18 hertz low-pass filter and captured on the spectrum-analyser using a sampling rate of 1024 samples per second and a 1 second time history. Figure 12 shows this time-history taken at the tip of the tailplane.

3. RESULTS

The only mode of interest in this test was the mode at 11.4 hertz. Table 2 lists the transfer function measurements taken at the various locations, and Figure 13 illustrates the mode shape. For clarity, only the leading edge points are plotted. A fully detailed plot would reveal that there is no noticeable deformation of the fin and tailplane assembly. The mode is quite clearly a fuselage torsion mode. The location of a nodal line for this mode is made difficult by the small amplitudes of signals along the fuselage, and the fact that measurements were being made on the exterior of a box section undergoing torsion. However, Figure 13 indicates the relative motion of the surface of the fuselage and the tips of the wing and tailplane, with the area around the wing root being generally of such small displacement that analysis becomes extremely inaccurate using the impulsive technique adopted for this particular test.

From Figure 12, which shows the decay of the vibration in the mode, the damping is estimated to be approximately 1 percent of critical.

4. CONCLUSIONS

The vibration at 11.4 hertz, measured at the tailplane during flight tests, has been investigated and found to be a fuselage torsion mode.

It has been demonstrated that for lightly damped and well separated modes, such as the one described here, a simple impulsive testing technique is adequate for modal identification. Accurate location of nodal lines is not so easy because of the limits placed on the input energy levels using this technique. A complete ground vibration test with distributed input forces still remains the ideal method to obtain such information.

REFERENCES

1. Goldman, A. Resonance Tests on the Tail of a CT4 Aircraft.
ARL-STRUC-TECH-MEMO-345 September 1982.

TABLE 1(a) LOCATION OF TAILPLANE MEASURING STATIONS

Distance from Aircraft Centre- Line (cm)	Distance from Tailplane leading edge (cm)			
	12.5	32.5	45.0	80.0
12.5	T4A T5A	T4B T5B	T4C T5C	T4D T5D
77.5	T3A T6A	T3B T6B	T3C T6C	T3D T6D
150.0	T2A T7A	T2B T7B	T2C T7C	T2D T7D
160.0	T1A T8A	T1B T8B		T1D T8D

TABLE 1(b) LOCATION OF FIN MEASURING STATIONS

Distance from tailplane (cm)	Distance from fin leading edge (cm)		
	5.0	30.0	70.0
45	F2A		
105	F1A	F1B	F1C

TABLE 1 (c) LOCATION OF FUSELAGE MEASURING STATIONS

Distance aft of engine firewall (cm)	
5.0	H1A, H1B
275.0	H5A, H5B
327.0	H6A, H6B
382.5	H7A, H7B
432.5	H8A, H8B
482.5	H9B
522.5	H10B

TABLE 2. MEASUREMENTS OF TRANSFER FUNCTION IN THE MOLE AT 11.4 HERTZ

<u>Location</u>	<u>Amplitude</u>	<u>Phase (Degrees)</u>
T1A	0.88	-4
T1B	0.85	-2
T1D	0.77	1
T2A	0.88	-1
T2B	0.78	-1
T2C	0.76	-2
T2D	0.76	-2
T3A	0.33	-2
T3B	0.35	-2
T3C	0.43	-2
T3D	0.41	-2
T4A	0.04	-3
T4B	0.04	-4
T4C	0.07	-1
T4D	0.07	7
T5A	0.04	-187
T5B	0.05	-177
T5C	0.08	-184
T5D	0.05	-199
T6A	0.31	178
T6B	0.35	-182
T6C	0.43	-185
T6D	0.39	-190
T7A	0.68	-183
T7B	0.76	-183
T7C	0.76	-183
T7D	0.73	-189
T8A	0.87	-183
T8B	0.44	-184
T8D	0.77	175
F1A	0.18	184
F1B	0.16	-185
F1C	0.34	26
F2A	0.07	-185
H10B	0.007	24
H9B	0.017	-7
H8B	0.01	-11
H8A	0.004	-177
H7A	0.006	-176
H7B	0.004	-25
H5A	0.013	185
H5B	0.013	-13
H1A	0.005	-63
H1B	0.009	-42
W1A	0.25	-180
W1B	0.3	-180
W12A	0.22	-11
W12B	0.26	-12
		Port Wing Tip
		Starboard
		Wing Tip

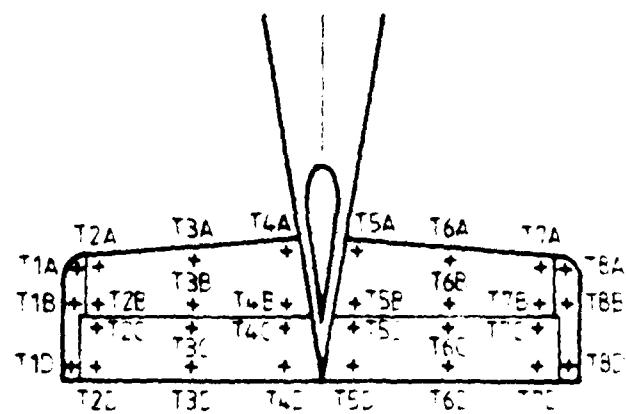
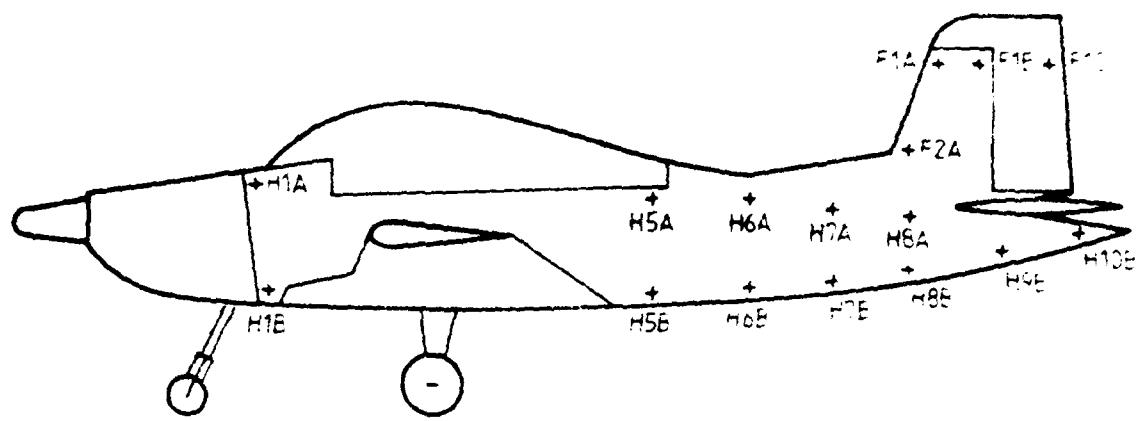


FIG. 4. LOCATION OF NEW FENG STATION

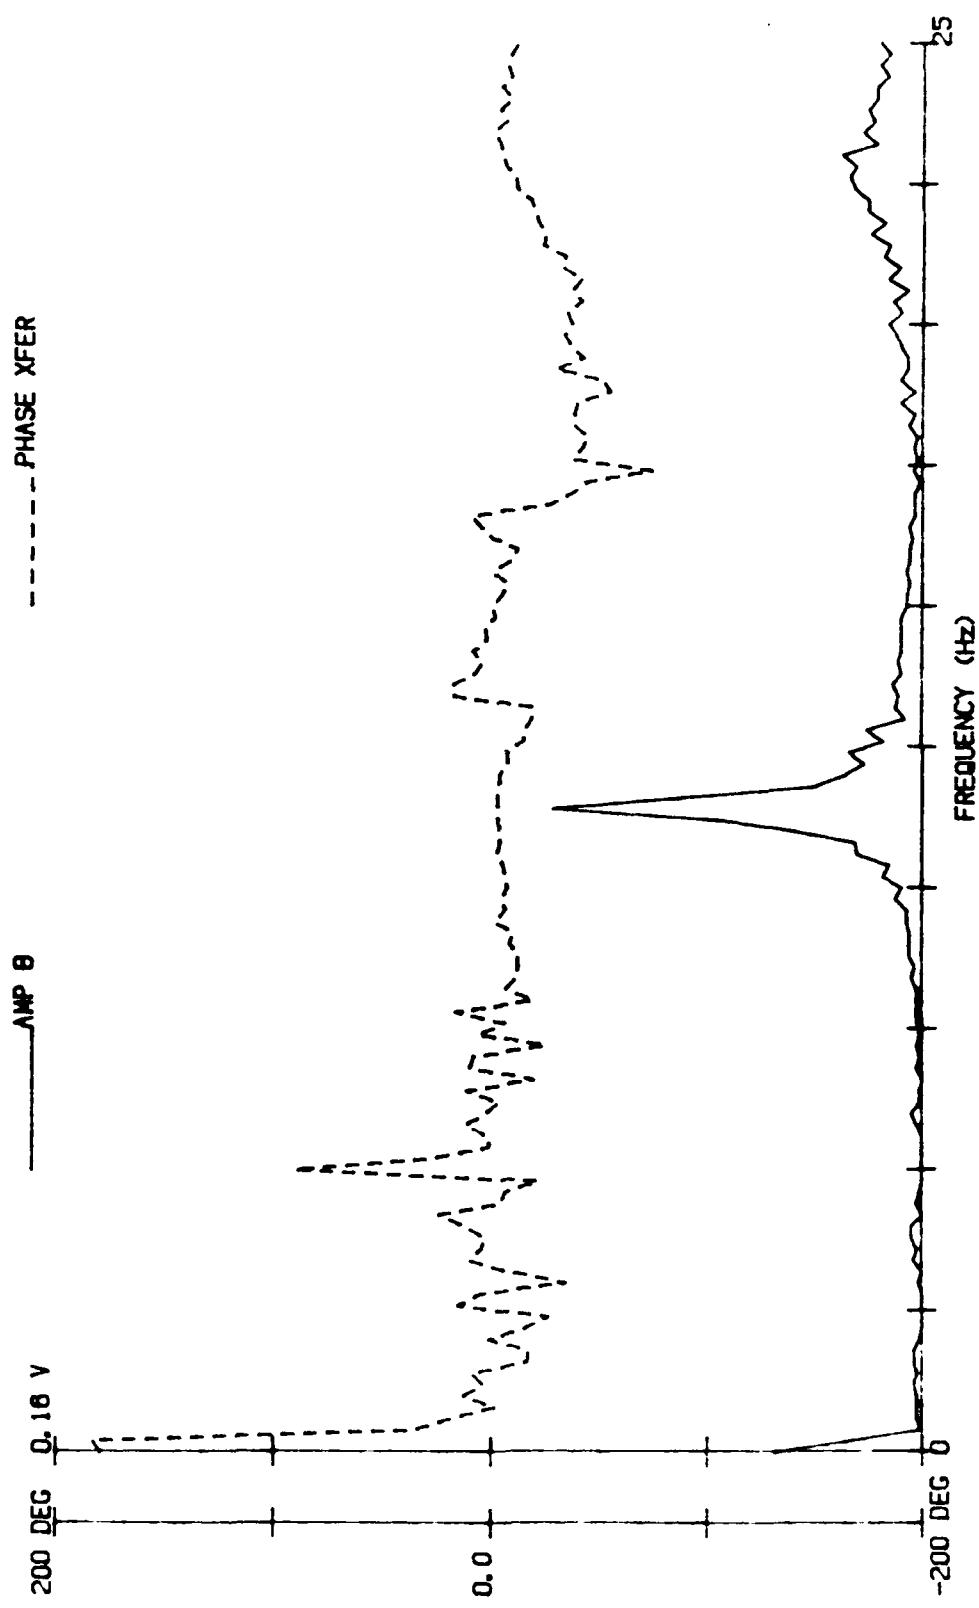


FIG. 2 RESPONSE AT LOCATION T1A

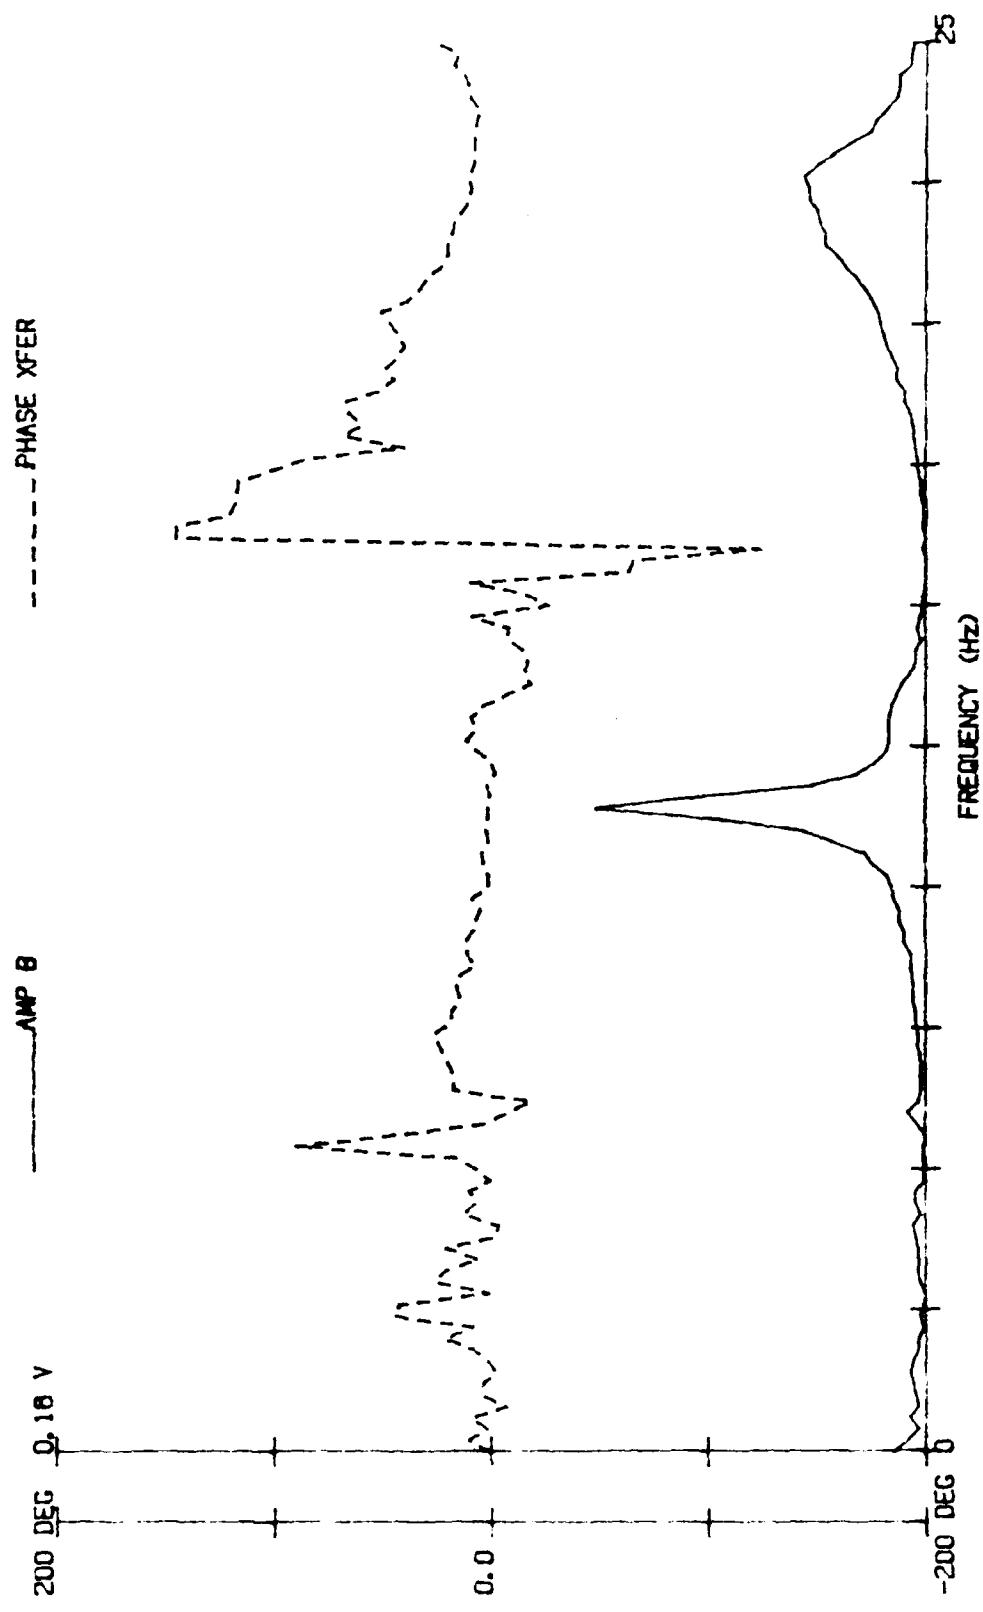


FIG. 3. RF REFLECTION COEFFICIENT FOR AMP B

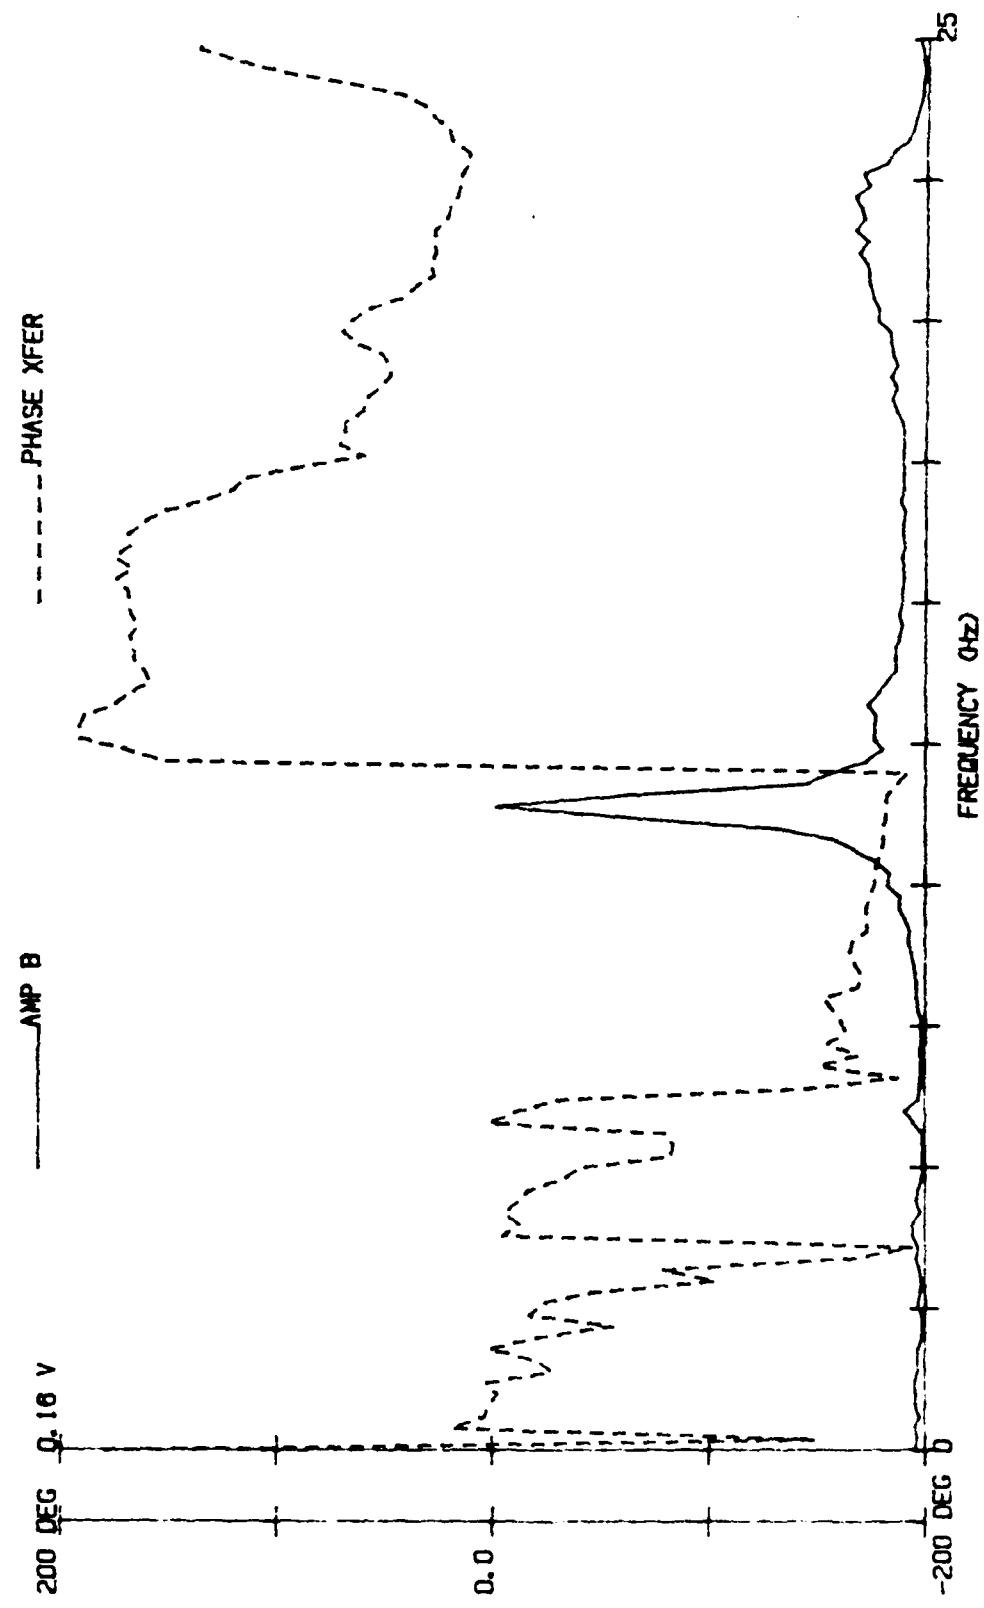


FIG. 4. RESPONSE AT LOCATION T A

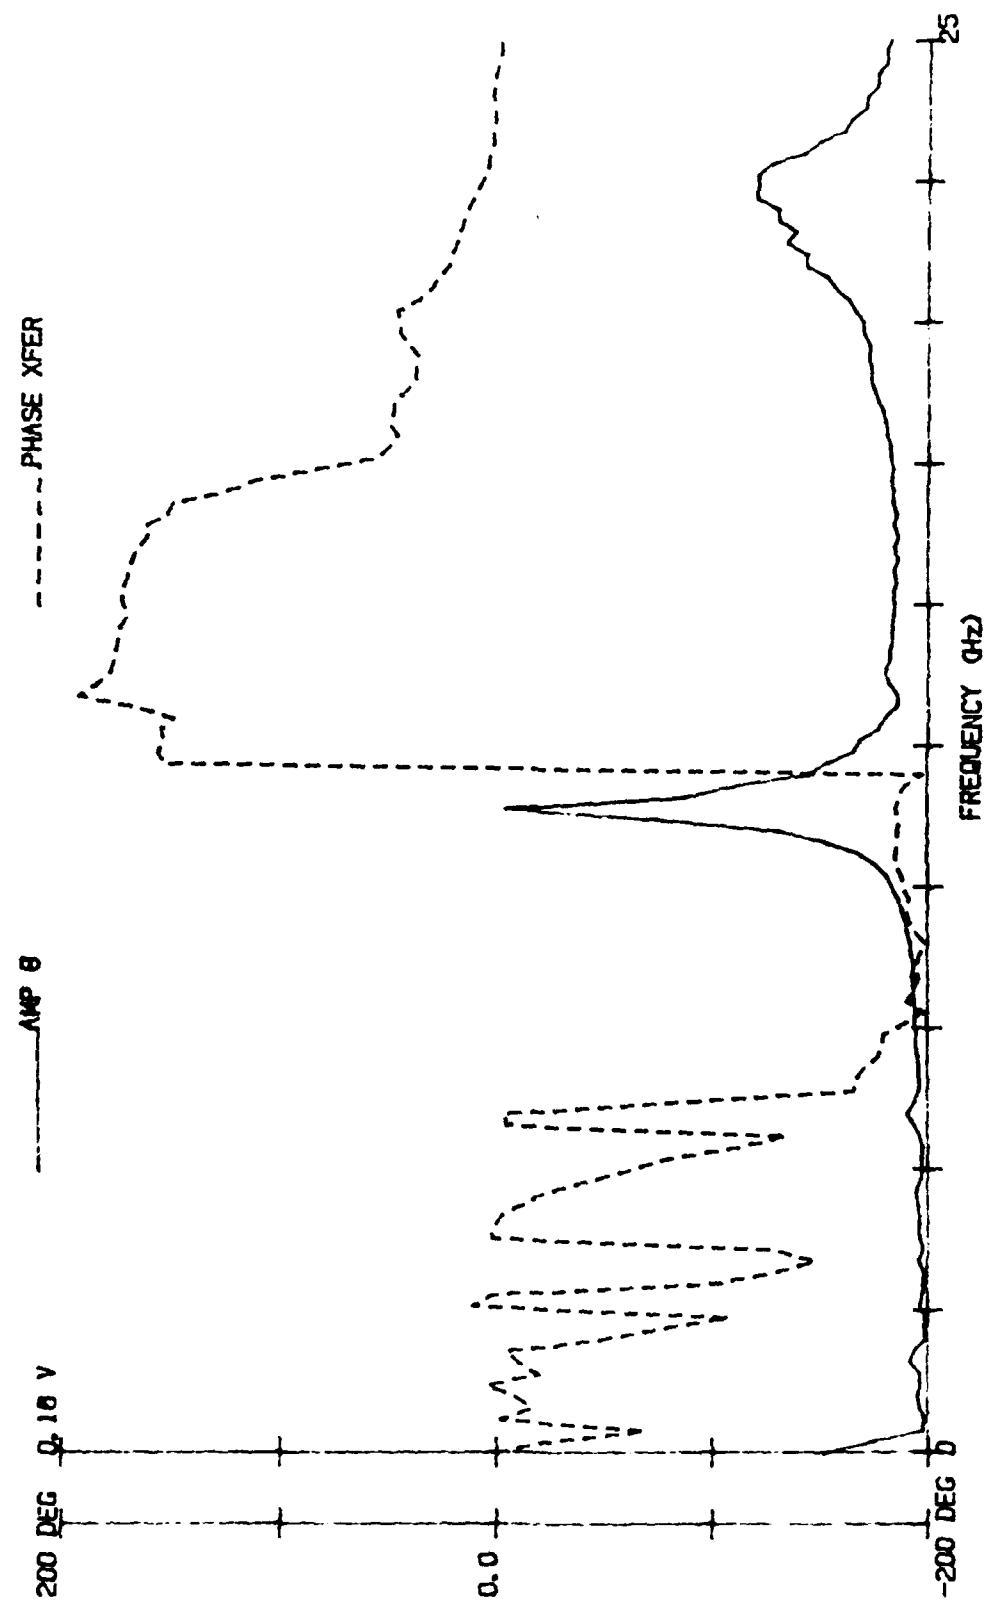


FIG. 5 RESPONSE AT LOCATION T1

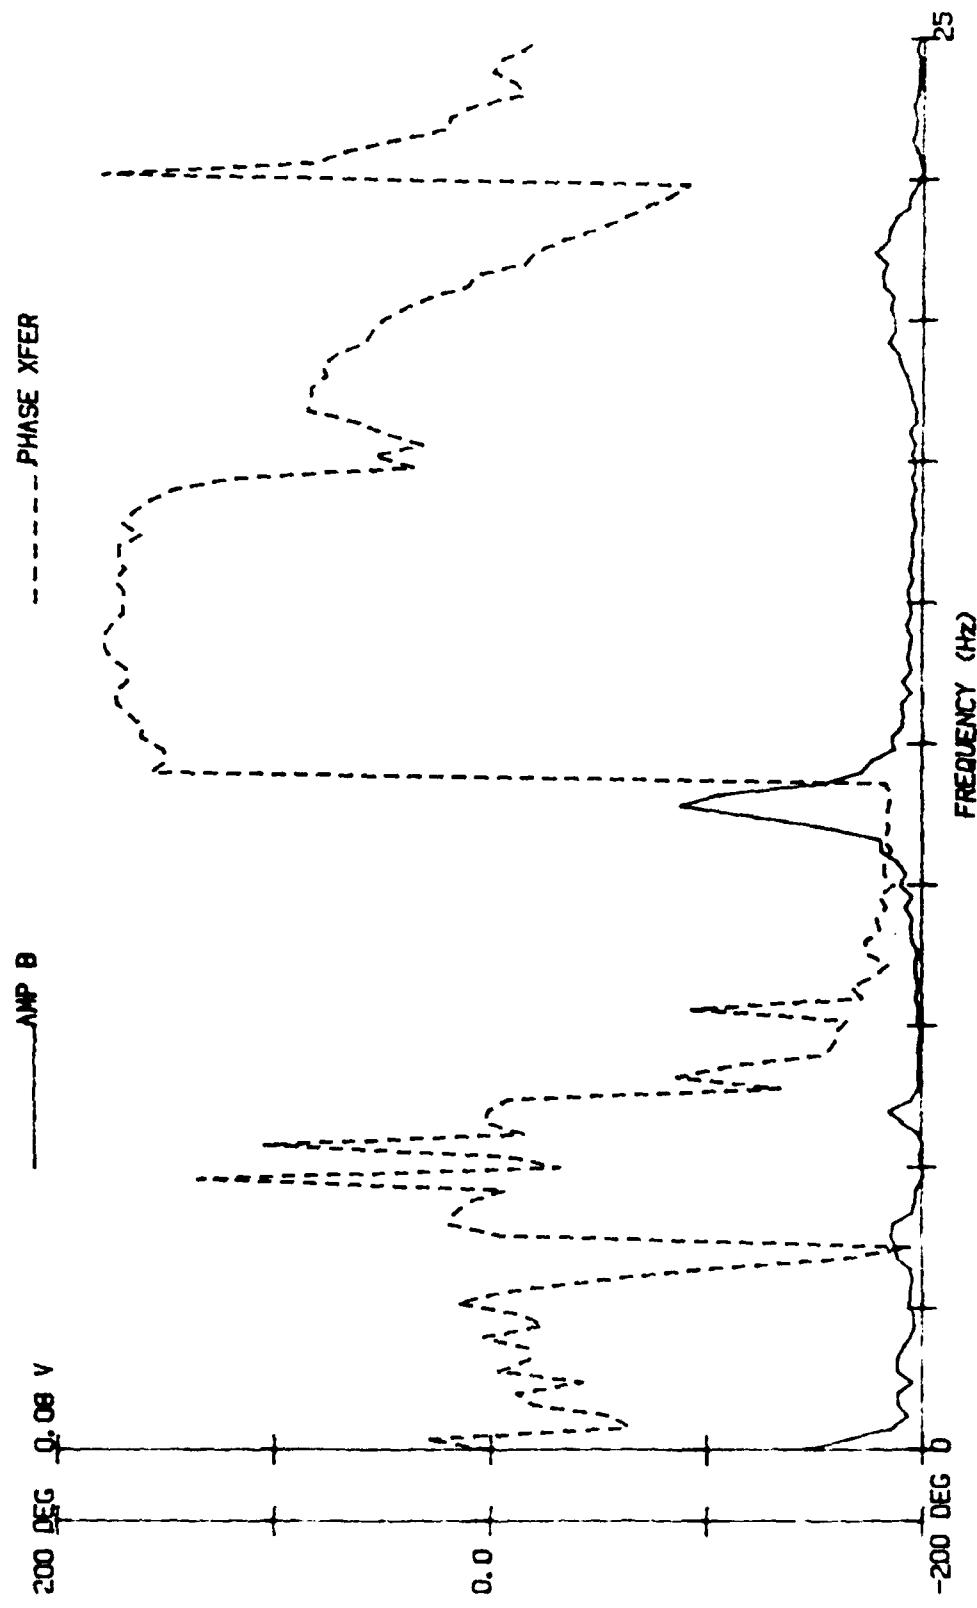


FIG. 6. RESPONSE AT LOCATION P1A

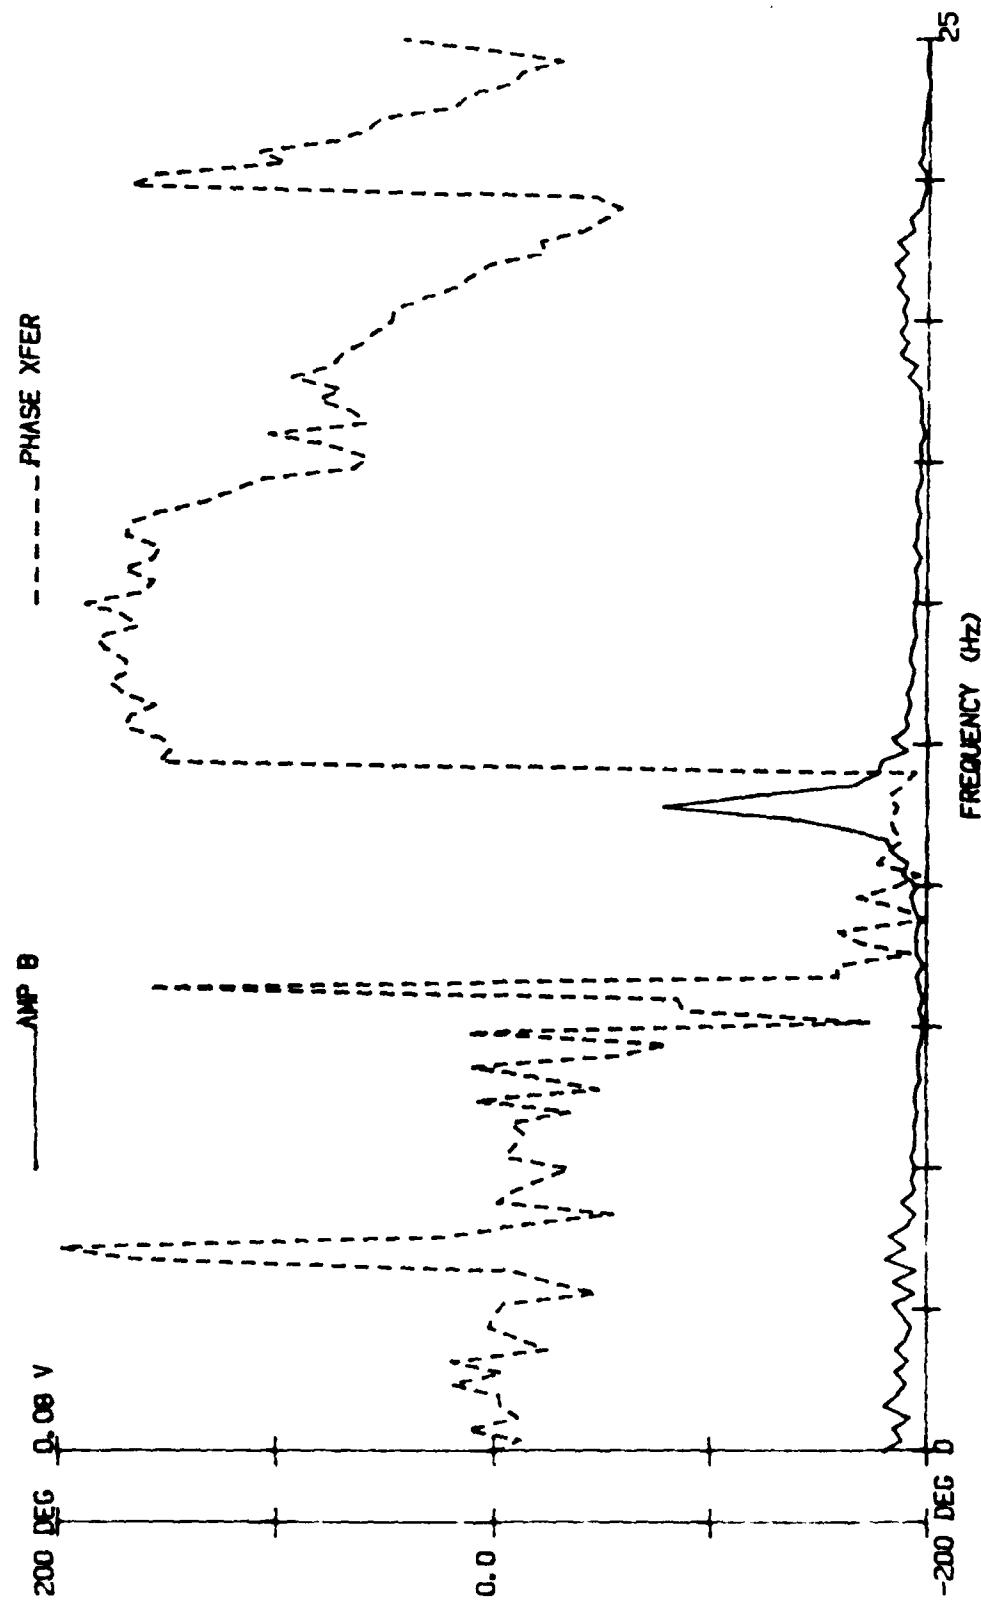


FIG. 7 FREQUENCY RESPONSE: 1:1

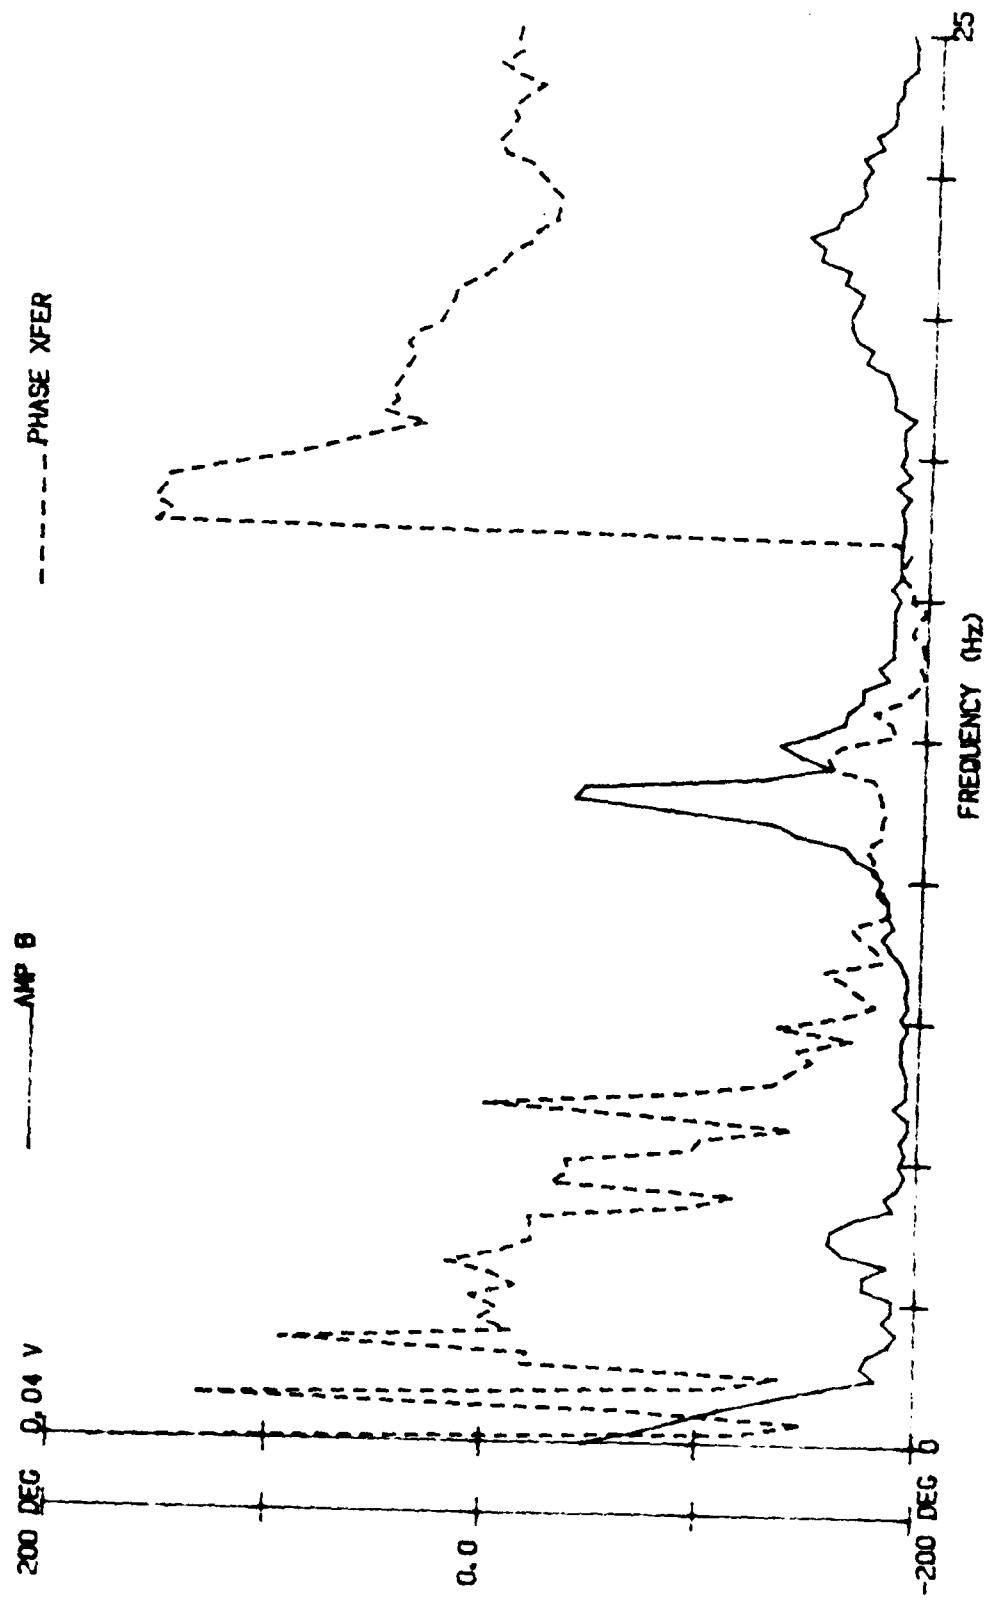


FIG. 3. RESPONSE AT L.E. PORT WITH

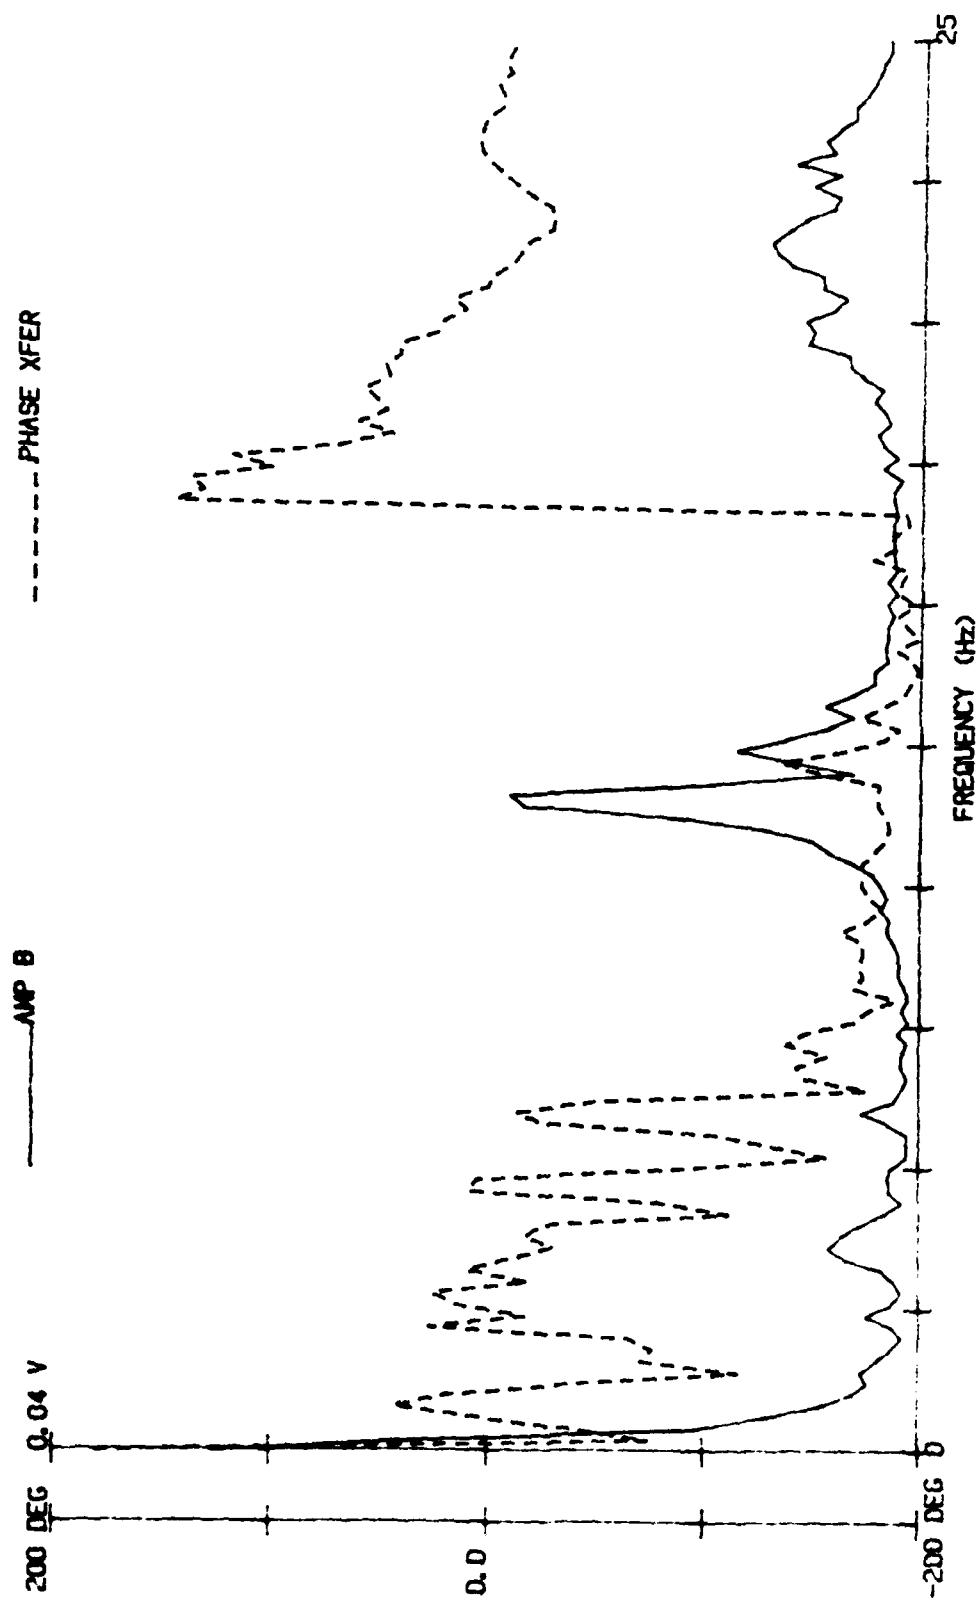


FIG. 9 RESPONSE AT T.E. PORT WING

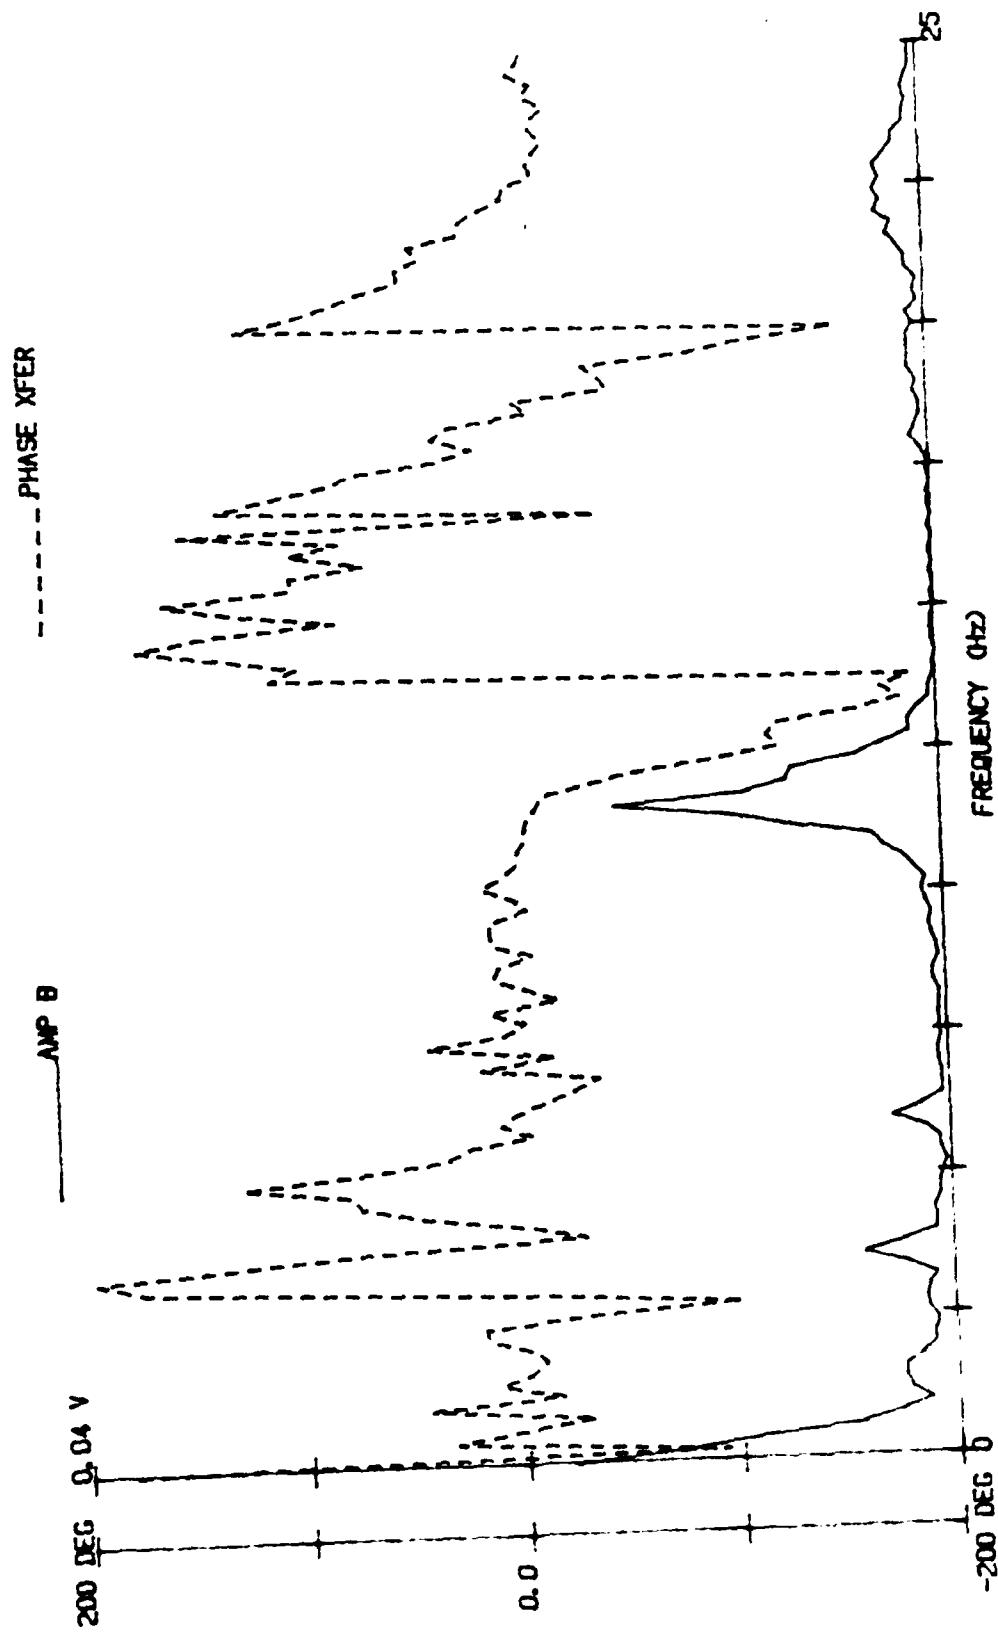


FIG. 10 RESPONSE AT I.E. 3700 WATT

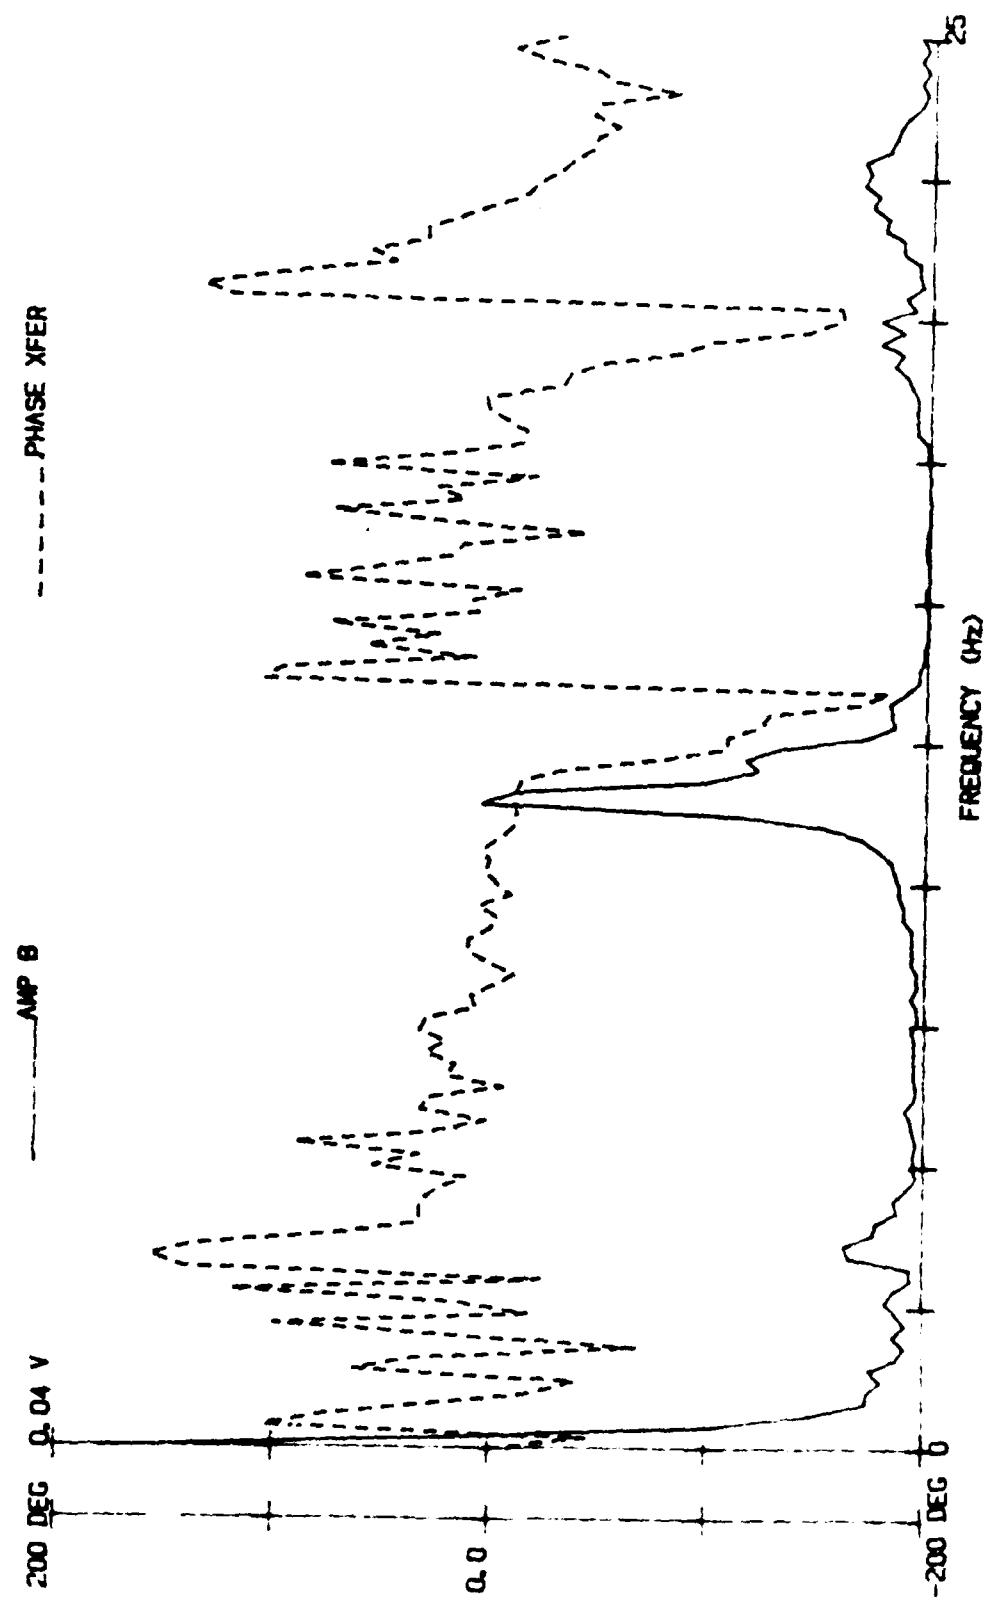


FIG. 11 RESPONSE AT T.F. 3700 WING



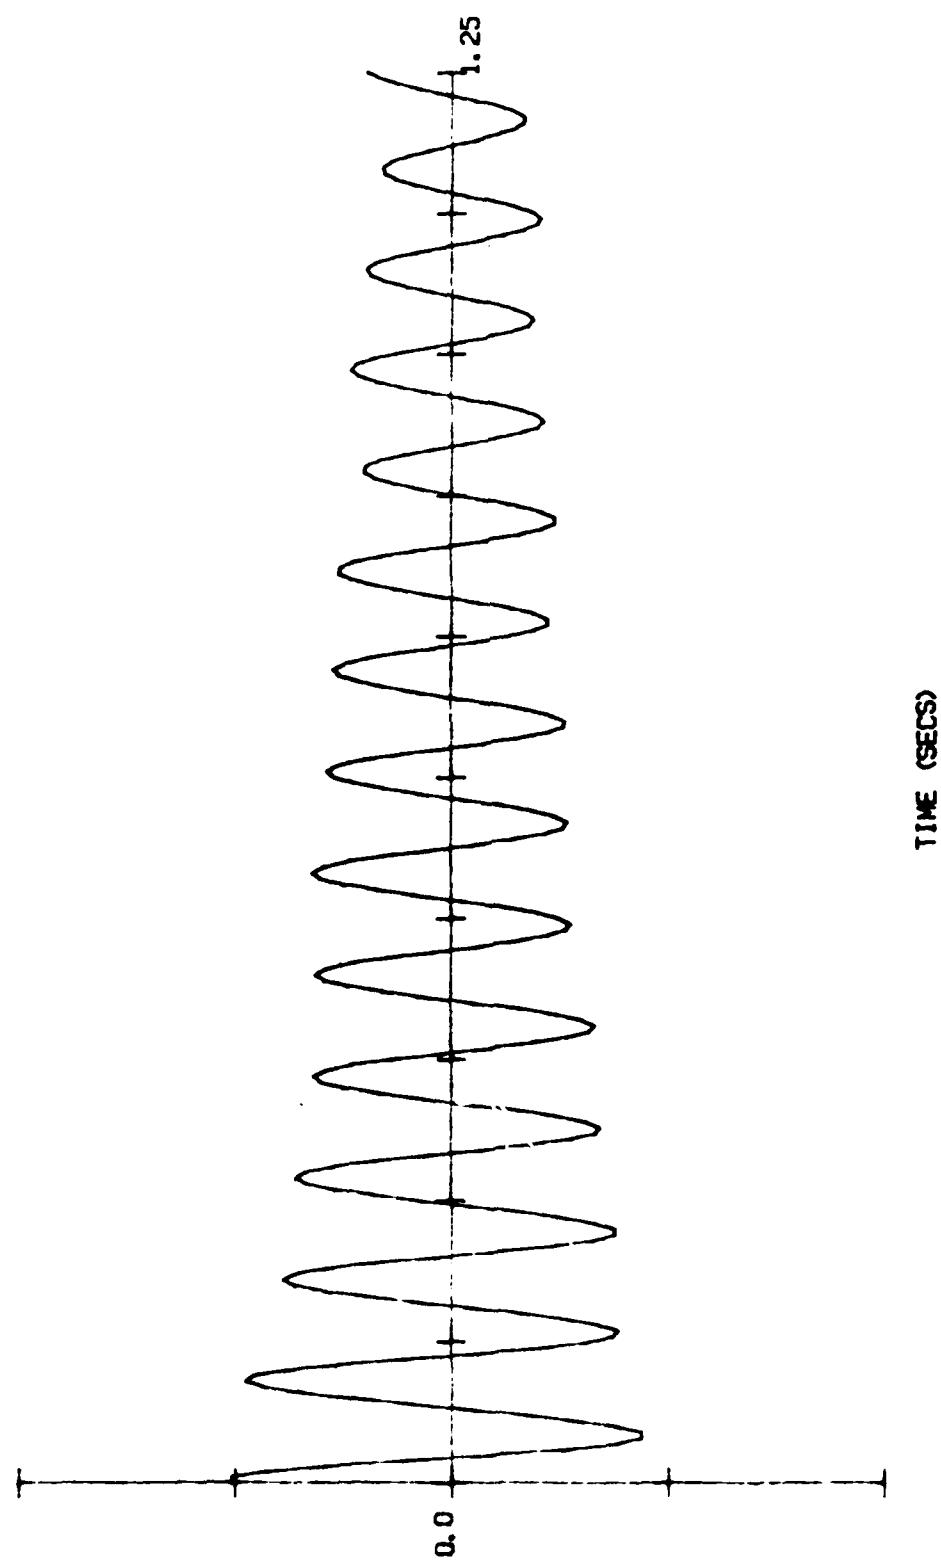


FIG. 1. RESPONSE FILTERED AT 18 Hz

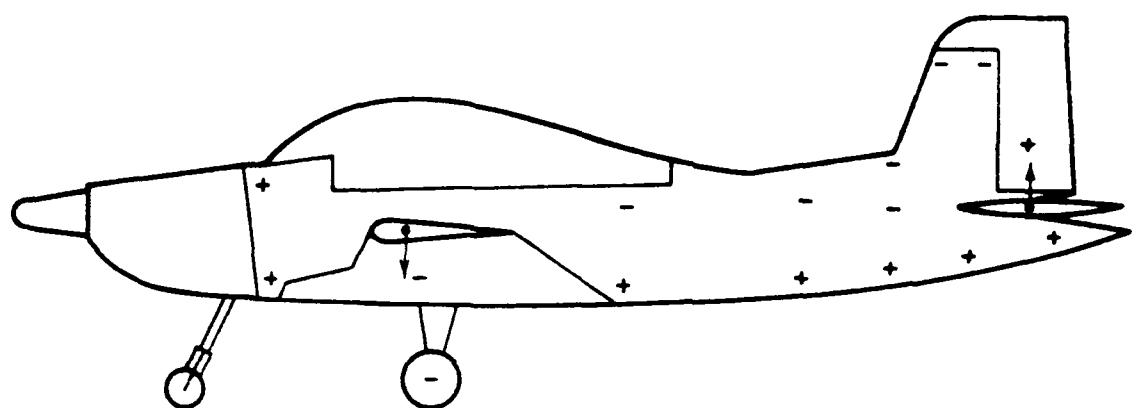

+ = Upwards and out of paper
- = Downwards and into paper

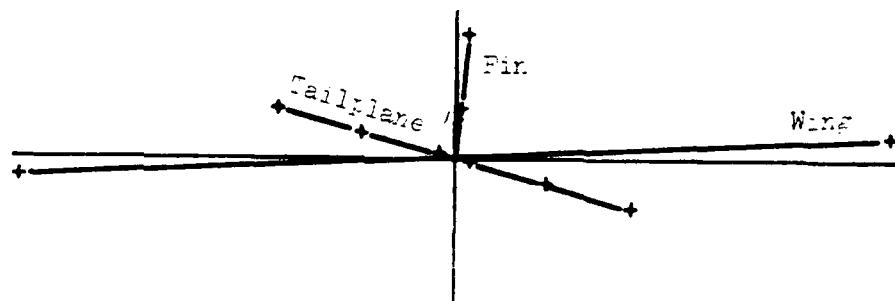

DISTRIBUTION

AUSTRALIA

Department of Defence

Central Office

Chief Defence Scientist)
Deputy Chief Defence Scientist)
Superintendent, Science and Technology Programmes) (1 copy)
Controller, Projects and Analytical Studies)
Defence Science Representative (U.K.) (Doc Data sheet only)
Counsellor, Defence Science (U.S.A.) (Doc Data sheet only)
Defence Central Library
Document Exchange Centre, D.I.S.B. (18 copies)
Joint Intelligence Organisation
Librarian H Block, Victoria Barracks, Melbourne
Director General - Army Development (NSO) (4 copies)
Defence Industry and Materiel Policy, FAS

Aeronautical Research Laboratories

Director
Library
Divisional File - Structures
Authors: A. Goldman
P. M. Cox

Materials Research Laboratories

Director/Library

Defence Research Centre

Library

Air Force Office

Air Force Scientific Adviser
Aircraft Research and Development Unit
Scientific Flight Group
Library
Director General Aircraft Engineering - Air Force

Central Studies Establishment

Information Centre

SPACES (10 copies)

TOTAL (50 copies)

Department of Defence
DOCUMENT CONTROL DATA

1 a AR No AR-002-393	1 b Establishment No ARL-STRUC-TECH-MEMO-368	2 Document Date DECEMBER 1983	3 Task No AIR 62/001
4. Title FUSELAGE TORSION OF A CT4 AIRCRAFT		5 Security a document UNCLASSIFIED b title c abstract U U	6 No Pages 6 7 No Refs 1
8. Authors PETRA M. COX A. GOLDMAN		9. Downgrading Instructions	
10 Corporate Author and Address AERONAUTICAL RESEARCH LABORATORIES P.O. BOX 4331, MELBOURNE, VIC. 3001		11 Authority (as appropriate) a Sponsor b Security c Downgrading d Approval	
12. Secondary Distribution (of this document) APPROVED FOR PUBLIC RELEASE			
Overseas enquirers outside stated limitations should be referred through ASDIS, Defence Information Services Branch, Department of Defence, Campbell, Park, CANBERRA ACT 2601			
13. a This document may be ANNOUNCED in catalogues and awareness services available to .. NO LIMITATIONS			
13 b Creation for other purposes (e.g. press announcement) may be (select) unrestricted (or) as for 13 a			
14. Descriptors RESONANT FREQUENCY AIRFRAMES IMPULSE LOADING CT4A AIRTRAINER		15. COSATI Group 0103	
16. Abstract The fuselage torsion mode of a CT4 aircraft has been examined using an impulsive testing technique. The mode shape and natural frequency are presented.			

This page is to be used to record information which is required by the Establishment for its own use but which will not be added to the DISTIS data base unless specifically requested.

16 Abstract (Contd.)


17 Imprint

AERONAUTICAL RESEARCH LABORATORIES, MELBOURNE.

18 Document Series and Number	19. Cost Code	20. Type of Report and Period Covered
STRUCTURES TECHNICAL MEMORANDUM 368	261010	

21. Computer Programs Used

22 Establishment File Ref(s)

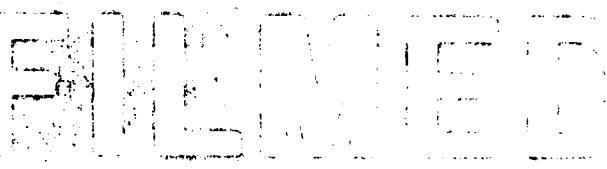

8